

Manhole Inspection Summary

Manhole # S39G__020MH

Printed On: 3/20/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **5) Immediate Attention Required**

Record Plat: **39G** Node: **020** Status: **Found**

Insp Date: **3/27/08 12:01 PM**

Incomplete Comments

Crew: **5**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **105 s. albemarle st**

Cross Street: **e. lombard st**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **None**

Comments **There is a hole in the barrel at 3, 18 feet down with water running fast out of it and other holes in the barrel. On the prints they have albemarle st in the wrong place. its the 1st street after s. front st not the 2nd one.**

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **9** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Partially Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **12** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S39G__020MH

Printed On: 3/20/2009

Page 2 of 5

Location View



Top View



Misc



barrel above pipe at 12

Misc



barrel at 3 18 down 2nd view

Defect 9



hole in barrel 18 down with water flowing fast out of it at 3

Defect 2



steps

Manhole Inspection Summary

Manhole # S39G__020MH

Printed On: 3/20/2009

Page 3 of 5

Defect 1



crack_frame missing part of frame

Defect 8



channel debris

Defect 6



bench debris

Defect 5



barrel_flow

Manhole Inspection Summary

Manhole # S39G__020MH

Printed On: 3/20/2009

Page 4 of 5

27 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **19.66** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

27 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow

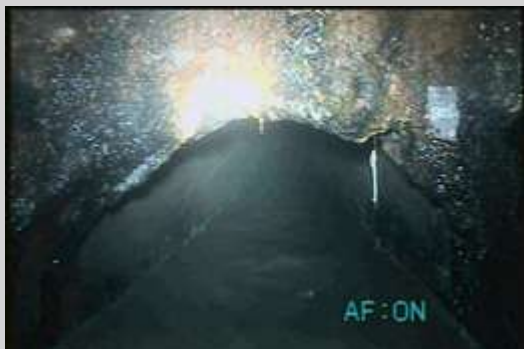

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **19.58** (ft.) Flow Characteristics: **Turbulent**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S39G__020MH

Printed On: 3/20/2009

Page 5 of 5

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **0** (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **18.20** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **4** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection